

## SLIM JIM ANTENNA

Made from 1/2 "copper pipe & elbow fittings soldered together. Use propane torch and copper pipe solder. Press fit all connections ... after polishing and applying flux to all pipe ends and lay flat on concrete surface to solder. Hang the end over a curb to solder it or rest entire assembly on bricks. Be sure it is flat & parallel prior to soldering.

See the next page for attachment is lower keeping repeating 1/4" attached to A. A VHF power meter with to C and the center conductor is until the lowest reading is obtained points 1/2" up or down. If the reading transmitter, take a reading and note it. the meter for lawest SWR. Turnon the tuning which is accomplished by moving an SWR scale is needed for optimum bottom. The cable shield is attached (reverse direction if reading is higher) movements in the same direction Turn off transmitter and move the tap the tap points up or down and checking is between 11/2to 3 inches from the Tap point for coaxial cableconnection

## Cutting Table

A = 5610/f + 2805/f B= (144/f) \* 1.5 C= 2805/f D = B E= (5610/f) -- B

Results are in inches,

f = the desired operating
frequency in megahertz
i.e. 88.1

## SLIM JIM ANTENNA

Attachment details

